

Service Technical Information

MODEL NO. CSD-MD5/MD30/MD50/MD70
SUBJECT MD unit does not operate (mechanism lockup)

REF.No. :G - A0 - 050 - E0

DATE :07. JUL. 2000


<CONTENTS>

On the models concerned, MD mechanism (7ZG-9) is locked up and completely disallows any operations. Take the following actions against the problem.

<COUNTERMEASURE>


Verify that the pins of MD mechanism (7ZG-9) indicated with arrows in the figure fit into the slits properly.

If the pins are off the slits, return the pins to the slits and then replace HLDR, SHILD TOP.

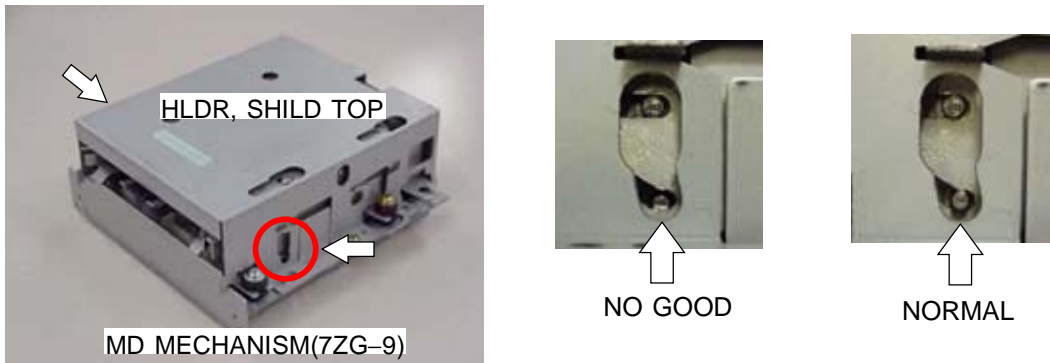

<NOTE>

When replacing HLDR, SHILD TOP, be sure to apply FLOIL (G-381) from inside.

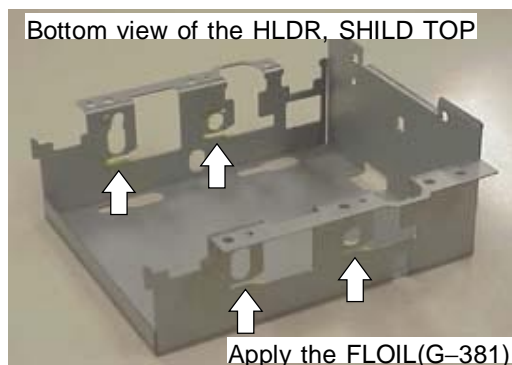

Ref.	Parts Code	Description	Remarks
-	87-ZG9-202-210	HLDR, SHILD TOP	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	-	-