

Service Technical Information

MODEL NO. CSD-MD50
SUBJECT Clock becomes loses only in ECO mode

REF.No. :G - 99 - 054 - E0

DATE :08. NOV. 1999

<CONTENTS>

Clock becomes loses in the model concerned. Take the following remedies on the model in question, regardless of presence or absence of the symptom.


<SYMPTOM>

In ECO mode, the system clock becomes loses by one minute per day under standby status.

<REMEDIES>

Take the following steps as shown in the figure below:

- 1) Remove the resist (a) off the P.W.B μ -COM/CD using a knife, etc.
- 2) Solder five wires of a repair P.W.B. SUB μ -COM.
- 3) Cut a cushion in half, and stick a piece of it on the P.W.B. SUB μ -COM.
- 4) Stick the P.W.B. SUB μ -COM with cushion onto the P.W.B μ -COM/CD. (on IC502 section).
- 5) Gather the wires and fix them down with CLOTH.
- 6) Lock down the P.W.B SUB μ -COM with glue (1600B) at four points.

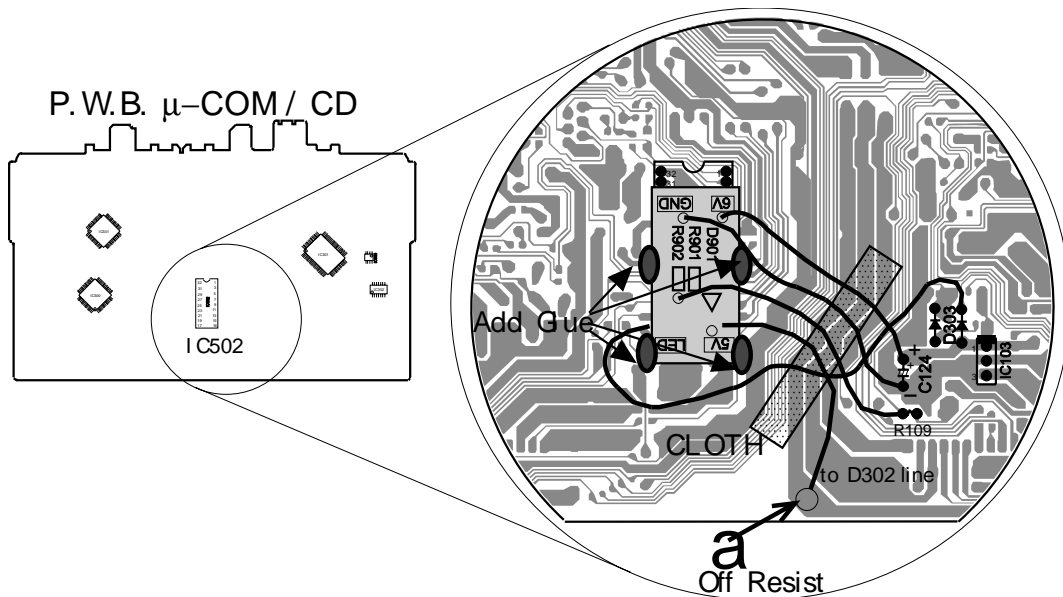

Ref.	Parts Code	Description	Remarks
-	8Z-CK3-640-010	PWB,SUB UCOM	-
-	8Z-CK3-249-010	CUSH, 20-45-5	-
-	87-NB5-219-010	CLOTH, 50-10	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	S01C-9AC0001	11.Nov.1999

