

# Service Technical Information

MODEL NO. XR-H66MD
SUBJECT MD does not operate

REF.No. :G - A0 - 072 - E0


DATE :22. SEP. 2000

<SYMPTOM>

The MD mechanism does not operate because of a PICK UP locking onto a shaft.  
Take the following action against the symptom.

<COUNTERMEASURE>

- 1) Remove SHAFT,PU GUIDE B from 3ZG-5.
- 2) Clean the shaft bearing of the PICK UP.
- 3) Replace SHAFT,PU GUIDE B with new one.
- 4) Apply grease (FLOIL 946P) to specified potion of the shaft.  
(Then, move the PICK UP a few times for lubrication.)

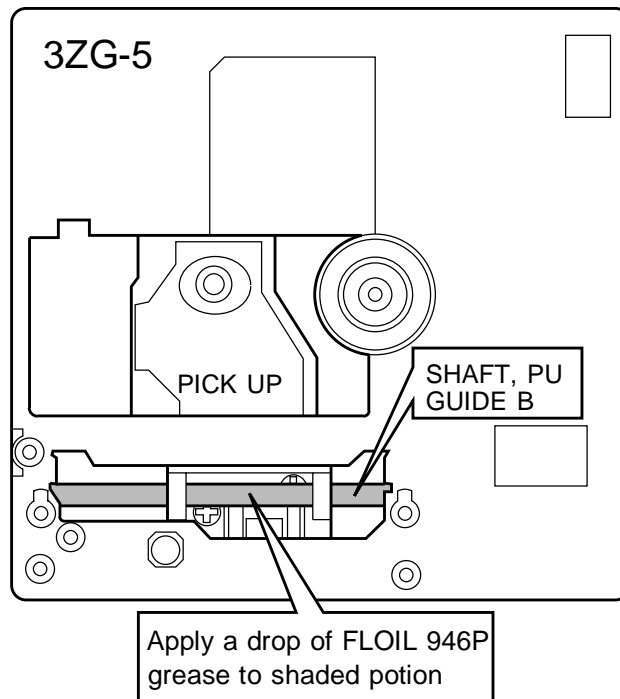

<NOTE>

If movement of the PICK UP does not become smooth even after the treatment above, replace the PICK UP with new one.

Ref.	Parts Code	Description	Remarks
-	83-ZG5-251-110	SHAFT, PU GUIDE B	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	S****83*0001 ~	-