

SONY®

Service Bulletin

NO: ME3-99-002

SUBJECT: DISC CANNOT BE TAKEN OUT, "PUSH RESET" APPEARS ON DISPLAY

DATE: JANUARY 1999**MODEL (S): MDX-60/61**

SYMPTOM: The disc may not be taken out. Then, "Push Reset" appears on the display. Even when pushing reset is done, disc may not come out. A Micro operation error, causes the Lock plate (holder) to not fit into hole of loading slider assembly.

SOLUTION: If this symptom occurs do the following countermeasure.

For MDX-60

Replace the Mounted Main Board.

Replace C909 (0.1uF) on the power board with a 2.2uF

Mount a 47Kohm resistor parallel to C932 (0.1uF)

DESCRIPTION	PART NUMBER
MOUNTED MAIN BD	A-3294-261-B
CAPACITOR (2.2μF/10V)	1-135-149-11
RESISTOR 47KΩ	1-216-841 -11

For MDX-61

Replace IC600 (CXP84648-004Q), with the one below.

DESCRIPTION	PART NUMBER
CXP846P48Q-1 -007	8-752-895-56

Applicable Serial Number Range: MDX-60/61 all units

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICESONAM 456
ME98025
ME03298