

SONY® Service Bulletin

NO: ME3-99-004

SUBJECT: DISC NOT BEING CHUCKED, OR WHEN PUSHING EJECT, DISC CANNOT COME OUT


DATE: JANUARY 1999

MODEL (S): MDX-C670/C7900/C8900

SYMPTOM: The disc is inserted and may not chuck, due to insufficient friction torque of lever (S) assembly. Pushing eject may cause this symptom.

SOLUTION: Please add the spring (KS2)/service assembly kit to lever (S). See illustration for detail.

DESCRIPTION	PART NUMBER
SPRING ASSEMBLY (KS2) ASSY	X-3376-538-2
GEAR (S)	3-919-315-02

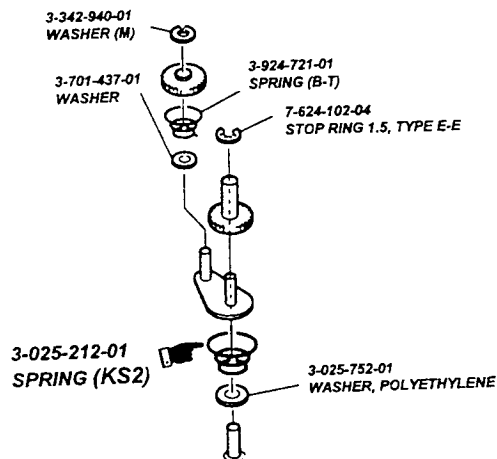

SONAM 454R1
ME98024

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE