

SONY®

Service Bulletin

NO:HIFI2-00-003

SUBJECT: No Rehearsal playback

DATE: July 2000

MODEL (S): MDS-JE530/JE630/JB930

Symptom: Rehearsal playback is stopped when AMS button is turned to the + direction to adjust position in DIVIDE or A-B ERASE rehearsal at the last track. ("Rehearsal" is on the display.)

Solution: Replace the microcomputer if it is on the following list.

Model	REF	FORMER		NEW	
		DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
JE530/JE630	IC501	M30624MG- 231FP	8-759-643-88	M30624MG- 242FP	8-759-657-07
JB930	IC800	M30624MG- 232FP	8-759-643-89	M30624MG- 243FP	8-759-657-08

AU99059

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - CONSUMER SERVICE