

# SONY® Service Bulletin

NO: HIFI2-99-014

**SUBJECT:** SPONTANEOUS RECORD


**DATE:** AUGUST 1999

**MODEL (S):** MZ-R55

**SYMPTOM:** The unit may enter RECORD mode when the STOP button is pressed or spontaneously, with no button pressed.


**SOLUTION:** Replace the RECORD Switch (S805) with the improved version. The improved record switch can be distinguished from the original switch by its gold terminals.

REF	FORMER		NEW	
	DESCRIPTION	PART NUMBER	DESCRIPTION	PART NUMBER
S805	RECORD SWITCH	1-771-331-41	RECORD SWITCH	1-771-331-51

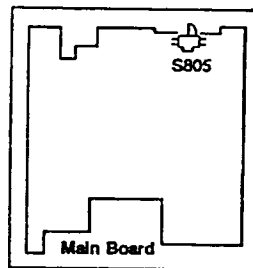

**NOTE:**

Add a black dot to the surface of the replacement Record Switch to distinguish the new part from the original. See insert.

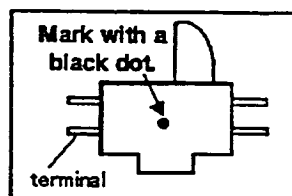

SONAM 499R1  
GA99015

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - CONSUMER SERVICE