

SONY®

Service Bulletin

NO:HIFI2-01-002

(1/2)

SUBJECT: MD disc will not Eject


DATE: February 2001

MODEL (S): MDS-JA20ES


Symptom: Customer complaint states disc does not eject.

Solution: Replace the HOLDER ASSY with new part (X-4949-789-6).

Apply HANARL SFL-9 grease (P/N 7-400-000-00) to HOLDER ASSY where indicated.

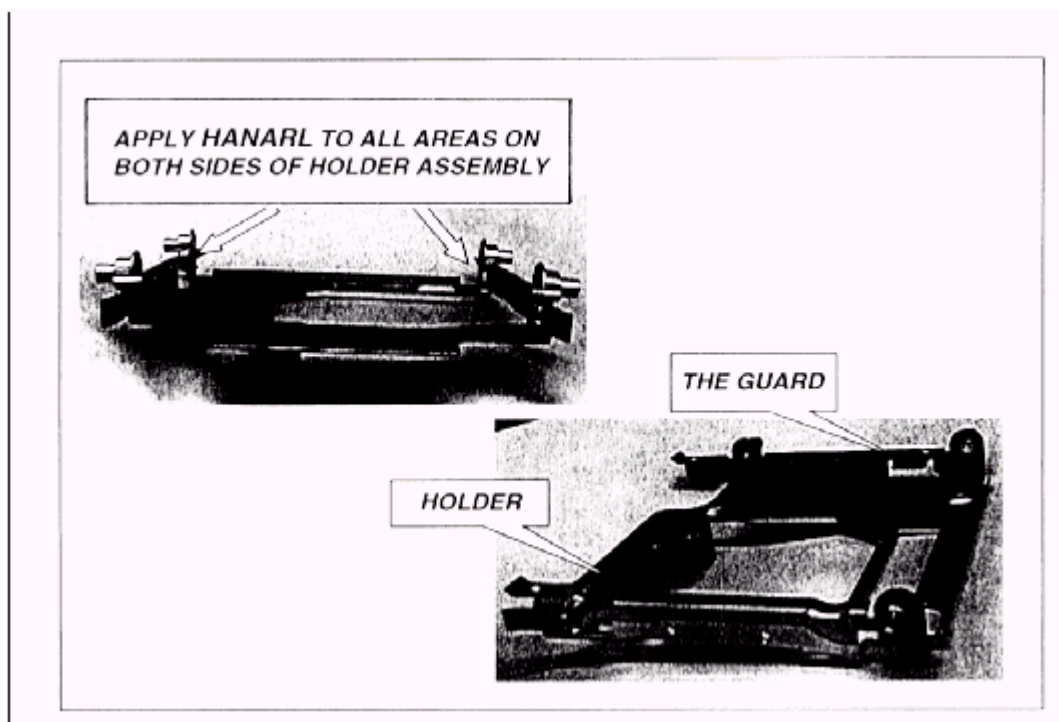

AU-00040
SONAM648

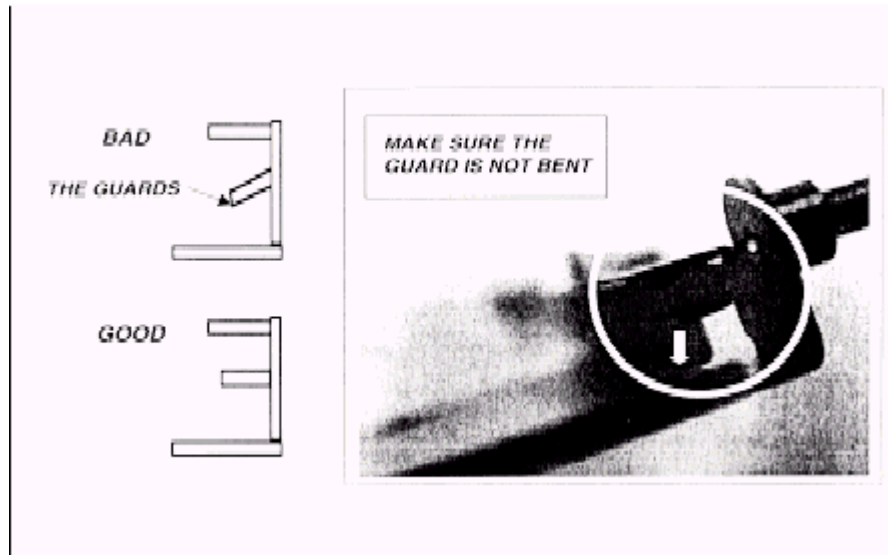

Make sure the guard is straight before you install the new HOLDER ASSY.

Applicable Serial Number range:

800001 ~ 801954