

SONY®

Service Bulletin

NO:HIFI2-01-007

SUBJECT: Precaution when replacing Microprocessors

DATE: April, 2001

MODEL (S): MDS-JE440, MDS-JE640

Symptom: Either IC1 or IC2 is diagnosed as defective.

Solution: If either IC1 or IC2 are defective then both IC's and peripheral parts should be changed.

MODEL	Description	REMOVE	ADD		
		Ref	Ref	Description	Part No
MDS-JE440	FLASH ROM	IC2	IC1	M30805-208GP	8-759-825-44
	MICON	IC1			
	Peripheral Parts	RB102,RB106,RB110,RB119,R52,R54,R69,R70,R1016	R16	0 ohm	1-216-864-11
MDS-JE640	FLASH ROM	IC2	IC1	M30805-209GP	8-759-827-37
	MICON	IC1			
	Peripheral Parts	RB102,RB106,RB110,RB119,R52,R54,R69,R70,R1016	R16	0 ohm	1-216-864-11

SONAM659
HA01MDS501