

SONY®

Service Bulletin

NO:HIFI2-01-016

SUBJECT: No playback

DATE: December, 2001


MODEL (S): MZ-E700, MZ-E900

Symptom: No playback, "NO DISC" or "DISC ERR" will be displayed.

Cause: Poor contact between CN501 and OP flexible cable.

Solution: Attach a sheet (connector) on the tip of the backing side of the OP flexible cable

Description	Part Number
SHEET(CONNECTOR)	3-232-142-01

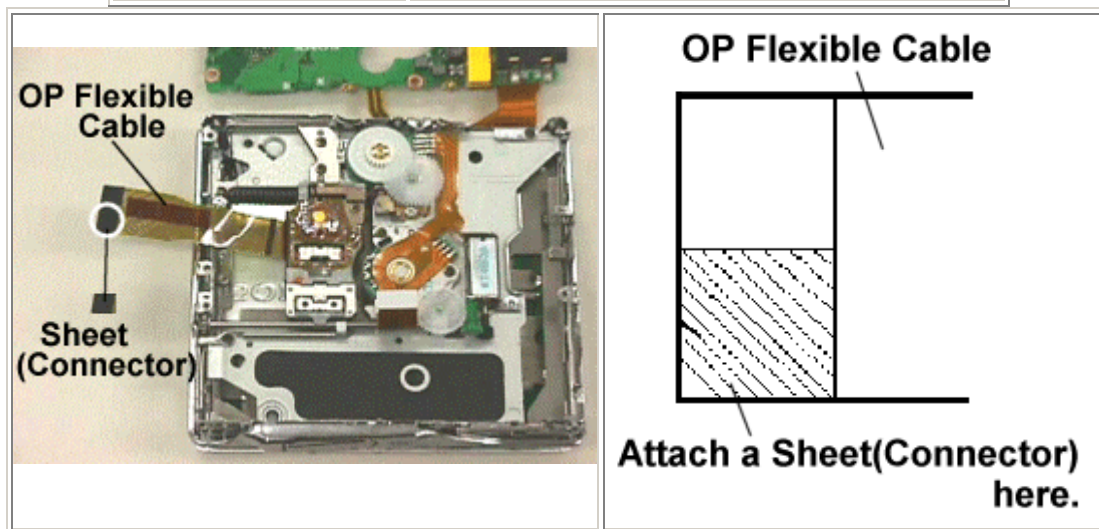

PA01PMZ538