



## Repair Tips

---

**SUBJECT:** Intermittent sound from headphone jack. Left and/or right disappears.

---

**DATE:** March, 2002

**MODEL (S):** MZ-R700

---

**Symptom:** Intermittent sound from headphone jack. Left and/or right disappears.

**Solution:** IC302 is being torn loose from PCB By torque from the headphone plug. With an MT-1500 solder station and an MT-211 tip, or equivalent, you can resolder the IC back down. This chip is a folded-under lead type.

**Submitted By:** PHD Electronics Ltd.

**Sony of Canada Ltd.**

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
**NATIONAL LAB - CONSUMER SERVICE**