

Repair tips

SUBJECT: No audio one side or both sides. Headphone plug is twisting the PCB

DATE: 06/22/2002

MODEL (S): MZ-N505

Symptom: No audio one side or both sides. Headphone plug is twisting the PCB

Solutions: Same as MZ-R700 but the IC302 is now glued. The glue chips off not too bad. Clear the pins on the side closest to the edge of the PCB (1-6). Re-solder these pins, the resisters and jumpers along the edge of the PCB. Test by tapping and running and heating. Some sound problems are under the IC801 and the board is toast.

Submitted By: PHD Electronics Ltd

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6
NATIONAL LAB - AVIT