

Service Technical Information

MODEL NO. AM-HX50 / HX55
SUBJECT With specific disc, unable to read TOC "DISC ERROR" appears

REF.No. :G - 99 - 051 - E0


DATE :02. NOV. 1999

<CONTENTS>

Unstable TOC reading may occur due to unstable disc holding.
Take the following countermeasure.

<COUNTERMEASURE>

Remove the top panel, and attach a rubber cushion onto the cartridge holder (see figure below).

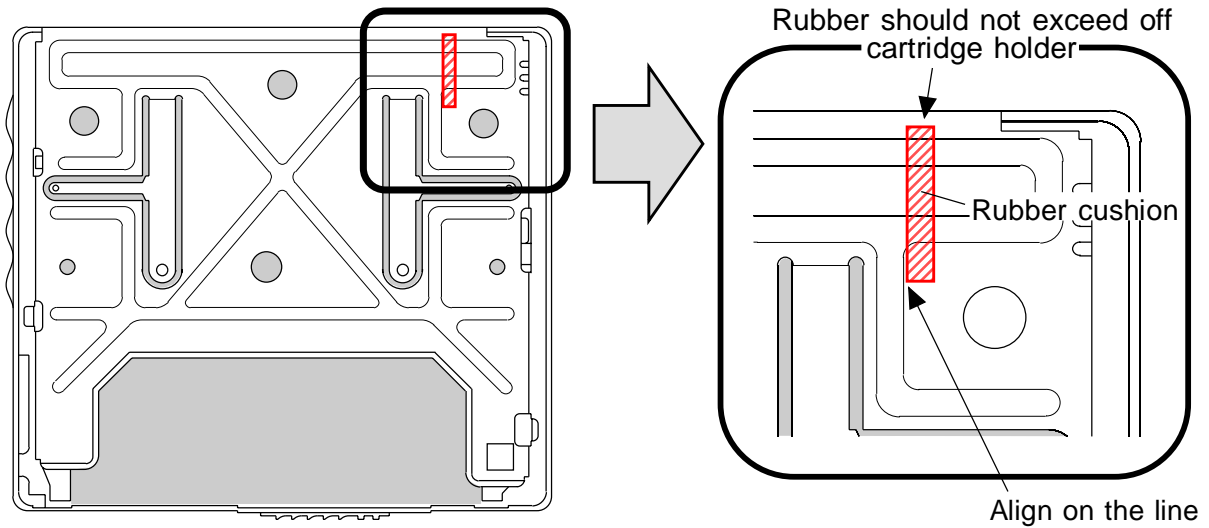

Ref.	Parts Code	Description	Remarks
-	8A-HM3-231-010	CUSH-R,CTRG	-

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	S****9B10001	9.Nov.1999