

# SONY®

## Service Bulletin

NO: PV2-02-006

**SUBJECT:** LS Guide Roller A, Parts Addition

**DATE:** January 2002

**MODEL (S):** MDX-M2000


**SYMPTOM:** When loading, it gets excessive stress.

**SOLUTION:** To add LS guide roller A mech chassis assy. Please order the Additional combination parts listed below:

Current combination	Additional combination
MECH CHASSIS Assy X-3951-300-1	MECH CHASSIS Assy X-3951-300-2
M1.4 SCREW 3-947-503-01	<b>LS GUIDE ROLLER, A</b> 3-074-309-01
	<b>1.2E RING</b> 7-624-101-04

The diagram illustrates the mechanical assembly of the LS Guide Roller A. It shows two configurations: the current state on the left and the updated state on the right. Both configurations feature a 'Mech Chassis Assy' at the base. In the current state, an 'M1.4 SCREW' is positioned on top of the roller assembly. In the updated state, a '1.2E RING' is added to the top, and an 'LS Guide Roller, A' is mounted on an 'LS Guide Shaft, A' which passes through the center of the roller assembly.

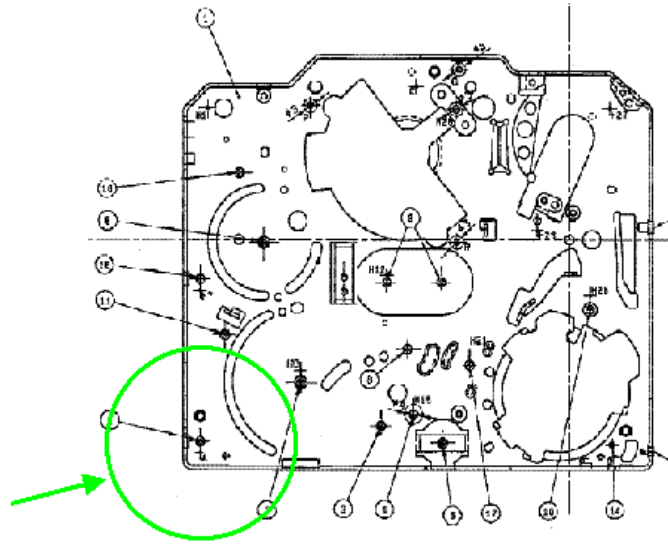

**Applicable Models:**

CCD-TR648E/ CCD-TR748E/ CCD-TR848/ CCD-TRV107/ CCD-TRV107E/  
CCD-TRV108/ CCD-TRV108E/ CCD-TRV208E/ CCD-TRV308/ CCD-TRV408/  
CCD-TRV408E/ CCD-TRV608/  
DCR-TRV130/ DCR-TRV130E/ DCR-TRV140/ DCR-TRV140E/ DCR-TRV230/  
DCR-TRV230E/ DCR-TRV235E/ DCR-TRV240/ DCR-TRV325E/ DCR-TRV330/  
DCR-TRV330E/ DCR-TRV340/ DCR-TRV340E/ DCR-TRV430E/ DCR-TRV530/  
DCR-TRV530E/ DCR-TRV725E/ DCR-TRV730/ DCR-TRV730E/ DCR-TRV828/  
DCR-TRV828E/ DCR-TRV830/ DCR-TRV830E

PV01DCR575

Sony of Canada Ltd.

115 Gordon Baker Road, Toronto, Ontario M2H-3R6  
NATIONAL LAB - AVIT